LCD-Stopwatches STRATOS

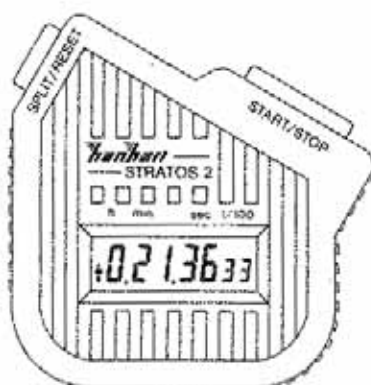|	
Measuring range:	9 h, 59 min., 59 sec., 99/100 sec.
Time unit:	1/100 sec.
Temperature range:	– 10° C up to + 55° C
Battery:	1 button cell 1,55 V, Type 389
Replacement of battery:	turn the round screw-plate on the rearside, change battery. Positive element (+) on top. Replace the screw-plate by turning in the opposite direction of the arrow.
Battery servicing:	about 1 year with a good quality battery.

STRATOS 1 + STRATOS 2

Reset:	press button *Reset* (Split / Reset)
Start / Stop	
Start:	press button *Start / Stop*
Stop:	press button *Start / Stop*
Reset:	press button *Reset (Split / Reset)*
Addition	
Start:	press button *Start / Stop*
Stop:	press button *Start / Stop* The time recording is interrupted, symbol ♦ is displayed. Repeat as often as required.
Reset:	press button *Reset* (Split / Reset)

STRATOS 2

Split:	intermediate times
Start:	press button *Start / Stop*
intermediate time I:	press button *Split / Reset* intermediate time I is displayed. Time keeps on counting internally. This is confirmed by displayed symbol Press again button *Split / Reset* Running time is displayed.
intermediate time II:	press button *Split / Reset* can be repeated as often as required.
Stop:	press button *Start / Stop* The displayed symbol means that time is stopped.
Reset:	press button *Split / Reset*

1 – 2 finish:	measuring 2 short successive times.
Start:	press button *Start / Stop*
Time I:	press button *Split / Reset*
Time II:	press button *Start / Stop*
reading:	time I is immediately displayed: (symbol) time II = press button *Split / Reset*, symbol
Reset:	press button *Split / Reset*